A. E. Fitzgerald
Charles Kingsley, Jr.
Stephen D. Umans

ELECTRIC MACHINERY

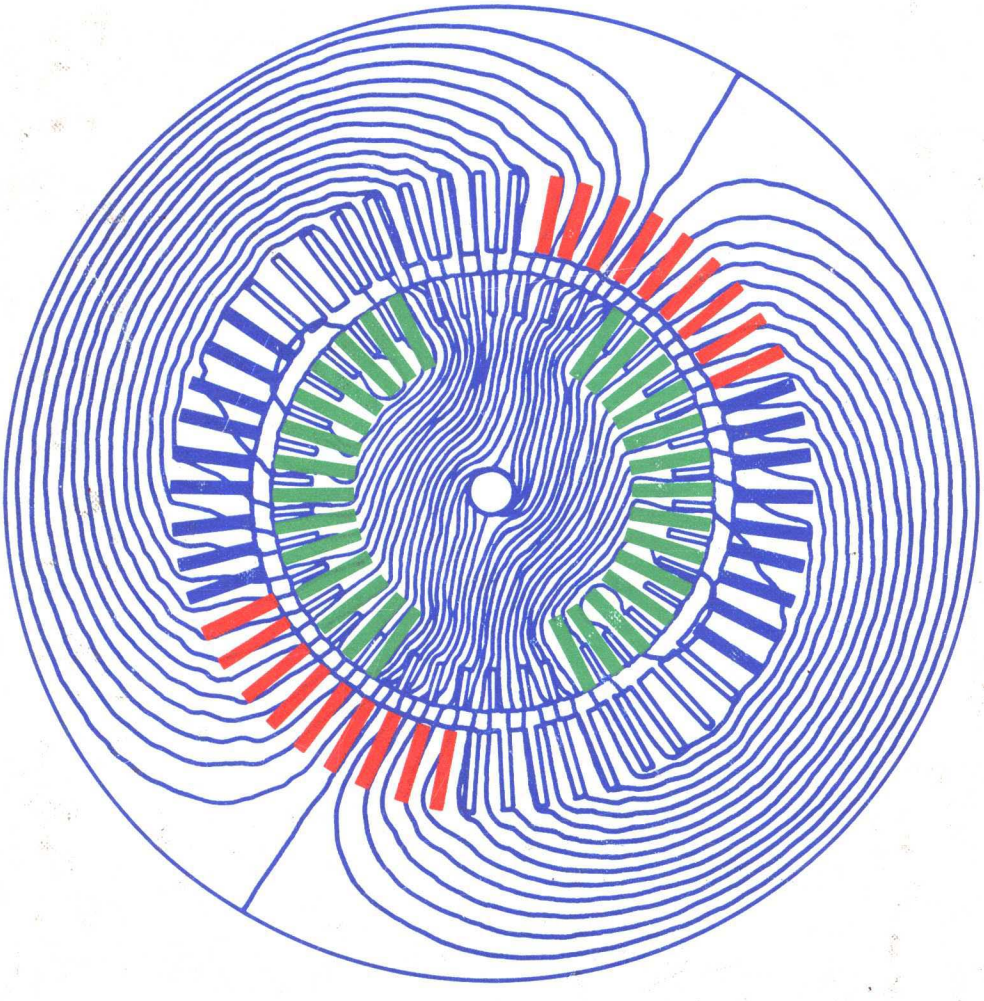

fourth edition

ELECTRIC MACHINERY

A. E. Fitzgerald

Late Vice President for Academic Affairs
and Dean of the Faculty
Northeastern University

Charles Kingsley, Jr.

Associate Professor of Electrical Engineering, Emeritus
Massachusetts Institute of Technology

Stephen D. Umans

Principal Research Engineer
Department of Electrical Engineering and Computer Science
Electric Power System Engineering Laboratory
Massachusetts Institute of Technology

McGraw-Hill Book Company

New York St. Louis San Francisco Auckland Bogotá Hamburg
Johannesburg London Madrid Mexico Montreal New Delhi
Panama Paris São Paulo Singapore Sydney Tokyo Toronto

ELECTRIC MACHINERY

Copyright © 1983, 1971, 1961 by McGraw-Hill, Inc. All rights reserved.
Copyright 1952 by McGraw-Hill, Inc. All rights reserved.
Copyright renewed 1980 by Rosemary Fitzgerald and Charles Kingsley, Jr.
Printed in the United States of America. Except as permitted under the United States Copyright Act of 1976, no part of this publication may be reproduced or distributed in any form or by any means, or stored in a data base or retrieval system, without the prior written permission of the publisher.

1 2 3 4 5 6 7 8 9 0 DOCDOC 8 9 8 7 6 5 4 3 2

ISBN 0-07-021145-0

This book was set in Century Schoolbook by York Graphic Services, Inc.
The editors were T. Michael Slaughter and David A. Damstra;
the designer was Charles A. Carson;
the production supervisor was Leroy A. Young.
New drawings were done by J & R Services, Inc.
R. R. Donnelley & Sons Company was printer and binder.

Library of Congress Cataloging in Publication Data

Fitzgerald, A. E. (Arthur Eugene), date
Electric machinery.

(McGraw-Hill series in electrical engineering. Power and energy)
Includes index.
1. Electric machinery. I. Kingsley, Charles, date . II. Umans, Stephen D. III. Title. IV. Series.
TK2181.F5 1983 621.31'042 82-7763
ISBN 0-07-021145-0 AACR2

ELECTRIC MACHINERY

McGraw-Hill Series in Electrical Engineering

Consulting Editor
Stephen W. Director, Carnegie-Mellon University

Networks and Systems
Communications and Information Theory
Control Theory
Electronics and Electronic Circuits
Power and Energy
Electromagnetics
Computer Engineering and Switching Theory
Introductory and Survey
Radio, Television, Radar, and Antennas

Previous Consulting Editors

Ronald M. Bracewell, Colin Cherry, James F. Gibbons, Willis W. Harman, Hubert Heffner, Edward W. Herold, John G. Linvill, Simon Ramo, Ronald A. Rohrer, Anthony E. Siegman, Charles Susskind, Frederick E. Terman, John G. Truxal, Ernst Weber, and John R. Whinnery

Power and Energy

Consulting Editor
Stephen W. Director, Carnegie-Mellon University

Elgerd: ELECTRIC ENERGY SYSTEMS THEORY: An Introduction
Fitzgerald, Kingsley, and Umans: ELECTRIC MACHINERY
Odum and Odum: ENERGY BASIS FOR MAN AND NATURE
Stevenson: ELEMENTS OF POWER SYSTEM ANALYSIS

试读结束：需要全本请在线购买： www.ertongbook.com

PREFACE

Like the three preceding editions of this book, the fourth edition presents a unified treatment of the basic theory of electromechanical devices with especial emphasis on the applications, control, and limitations of rotating electric machinery. Much of the text is taken from the best parts of the second and third editions, rearranged in a more logical sequence, and rewritten.

The topic of power electronics has received considerable attention in the past decade. A number of textbooks have been written on the subject, and it is available as a separate course in many electrical engineering curricula. It certainly requires more than a single chapter to do it justice. As a result, the chapter on solid-state motor control has been eliminated from the fourth edition. However, the concepts of solid-state control as applied to electric machinery have been retained in the form of an article discussing dc motor drives in Chapter 6 and an article discussing variable-frequency ac motor drives in Chapter 10.

This bit of reorganization gave us room to add some new material and to reinstate some material which had been included in the second edition. For example, the technique of the transformation to dq0 variables, so useful in the transient analysis of ac machinery, is again included. In addition, the book has been rearranged with the hope that it will be easier to use.

The first four chapters provide a basic introduction to the topic of energy conversion and to rotating electric machinery. The material of the second chapter on electromechanical energy conversion is often felt to be too mathematical for an introductory undergraduate course on electric machinery. In this edition, it has been written in such a fashion that the first two sections can serve as an overview of the topic and the rest of the chapter can be omitted if desired without a loss of understanding in the remainder of the book.

The chapters on dc, synchronous, and induction machinery have been grouped in pairs. In each of these groupings, the first chapter serves as an

introduction to the machine type, develops the basic models, and applies them to the steady-state performance of the machine. The second chapter then deals with the issues associated with the control and transient behavior of the machine as well as some of the more subtle issues not required for the development of the basic models.

This book does not require a level of mathematical sophistication beyond that given in undergraduate courses in basic physics and circuit theory. The emphasis is on physical understanding as the basis for mathematical models.

Obviously more material is presented than can be treated in the time available in the typical curriculum. Moreover, the detailed content and order of subject matter are naturally governed by local circumstances and the desires and enthusiasms of individual instructors. For these reasons, particular attention is given to flexibility of use without loss of continuity. Browsing in the book for an hour or two and reading the introductory paragraphs of each chapter should enable an instructor to outline a variety of courses with differing content and sequence. Furthermore the book should serve the student as a reference text during his subsequent professional career.

The untimely death of Dr. A. E. Fitzgerald in July 1978 was a great loss of a coauthor and personal friend of many years. His sound intuitive judgment and lucid writing style are contributions that are hard to replace. However, much of his writing taken from the earlier editions has been retained in this fourth edition.

During the preliminary planning for the fourth edition, Dr. Alexander Kusko, a coauthor of the third edition, decided that he could no longer spare the time from his active consulting business to take part in the revision.

With the loss of these two coauthors I feel very fortunate to have been able to interest Dr. Stephen D. Umans in joining me in this new edition. Without his energy, enthusiasm, and conscientious adherence to a time schedule, the production of the fourth edition would have been difficult. From my point of view I have found working with him to be a very satisfying experience.

Charles Kingsley, Jr.

ELECTRIC MACHINERY

CONTENTS

Preface xi

1/Magnetic Circuits and Transformers 1

1-1 INTRODUCTION TO MAGNETIC CIRCUITS 2
1-2 FLUX LINKAGE, INDUCTANCE, AND ENERGY 9
1-3 PROPERTIES OF MAGNETIC MATERIALS 14
1-4 AC EXCITATION 17
1-5 INTRODUCTION TO TRANSFORMERS 24
1-6 NO-LOAD CONDITIONS 26
1-7 EFFECT OF SECONDARY CURRENT; IDEAL TRANSFORMER 30
1-8 TRANSFORMER REACTANCES AND EQUIVALENT CIRCUITS 33
1-9 ENGINEERING ASPECTS OF TRANSFORMER ANALYSIS 38
1-10 TRANSFORMERS IN THREE-PHASE CIRCUITS 48
1-11 THE PER UNIT SYSTEM 52
1-12 AUTOTRANSFORMERS; MULTICIRCUIT TRANSFORMERS 57
1-13 SUMMARY 60
PROBLEMS 62

2/Electromechanical Energy-Conversion Principles 71

2-1 FORCES AND TORQUES IN MAGNETIC FIELD SYSTEMS 72
2-2 ENERGY BALANCE 76
2-3 ENERGY AND FORCE IN SINGLY EXCITED MAGNETIC FIELD SYSTEMS 78
2-4 DETERMINATION OF MAGNETIC FORCE; COENERGY 83
2-5 MULTIPLE EXCITED MAGNETIC FIELD SYSTEMS 90
2-6 DYNAMIC EQUATIONS 94
2-7 ANALYTICAL TECHNIQUES 99
2-8 SUMMARY 104
PROBLEMS 105

3/**Rotating Machines:** Basic Concepts 117

3–1 ELEMENTARY CONCEPTS 117
3–2 INTRODUCTION TO AC AND DC MACHINES 120
3–3 MMF OF DISTRIBUTED WINDINGS 131
3–4 MAGNETIC FIELDS IN ROTATING MACHINERY 140
3–5 ROTATING MMF WAVES IN AC MACHINES 143
3–6 GENERATED VOLTAGE 150
3–7 TORQUE IN NON-SALIENT-POLE MACHINES 155
3–8 SUMMARY 165
PROBLEMS 167

4/**Engineering Aspects of Practical Electric-Machine Performance** 175

4–1 MAGNETIC SATURATION 175
4–2 LEAKAGE FLUXES 178
4–3 LOSSES 181
4–4 RATING AND HEATING 184
4–5 COOLING MEANS FOR ELECTRIC MACHINES 188
4–6 EXCITATION SOURCES 190
4–7 ENERGY EFFICIENCY OF ELECTRIC MACHINERY 193
4–8 THE NATURE OF MACHINERY PROBLEMS 194
4–9 SUMMARY 196
PROBLEMS 197

5/**DC Machines:** Steady State 201

5–1 INTRODUCTION TO DC MACHINES 201
5–2 COMMUTATOR ACTION 208
5–3 EFFECT OF ARMATURE MMF 211
5–4 ANALYTICAL FUNDAMENTALS: ELECTRIC-CIRCUIT ASPECTS 214
5–5 ANALYTICAL FUNDAMENTALS: MAGNETIC-CIRCUIT ASPECTS 217
5–6 ANALYSIS OF STEADY-STATE PERFORMANCE 221
5–7 COMMUTATION AND INTERPOLES 230
5–8 COMPENSATING WINDINGS 233
5–9 SUMMARY; DC MACHINE APPLICATIONS 235
PROBLEMS 237

6/**DC Machine Dynamics and Control** 247

6–1 DC MOTOR SPEED CONTROL 247
6–2 DYNAMIC EQUATIONS 251

6-3 TRANSFER FUNCTIONS AND BLOCK DIAGRAMS OF DC MACHINES 254
6-4 EFFECTS OF SATURATION: SELF-EXCITED GENERATORS 266
6-5 INTRODUCTION TO RECTIFIER CIRCUITS 270
6-6 SOLID-STATE DC MOTOR-DRIVE SYSTEMS 280
6-7 AN ELEMENTARY MOTOR-SPEED REGULATOR 290
6-8 METADYNES AND AMPLIDYNES 295
6-9 SUMMARY 298
PROBLEMS 299

7/**Synchronous Machines:** Steady State 311

7-1 INTRODUCTION TO POLYPHASE SYNCHRONOUS MACHINES 312
7-2 SYNCHRONOUS-MACHINE INDUCTANCES; EQUIVALENT CIRCUITS 314
7-3 OPEN- AND SHORT-CIRCUIT CHARACTERISTICS 320
7-4 STEADY-STATE POWER-ANGLE CHARACTERISTICS 328
7-5 STEADY-STATE OPERATING CHARACTERISTICS 334
7-6 EFFECTS OF SALIENT POLES; INTRODUCTION TO DIRECT- AND QUADRATURE-AXIS THEORY 339
7-7 POWER-ANGLE CHARACTERISTICS OF SALIENT-POLE MACHINES 345
7-8 INTERCONNECTED SYNCHRONOUS GENERATORS 349
7-9 SUMMARY 351
PROBLEMS 352

8/**Synchronous Machines:** Transient Performance 361

8-1 SYNCHRONOUS-MACHINE TRANSIENTS 362
8-2 TRANSFORMATION TO DIRECT- AND QUADRATURE-AXIS VARIABLES 364
8-3 BASIC MACHINE RELATIONS IN dq0 VARIABLES 367
8-4 ANALYSIS OF A SUDDEN THREE-PHASE SHORT CIRCUIT 371
8-5 TRANSIENT POWER-ANGLE CHARACTERISTICS 379
8-6 EFFECTS OF ADDITIONAL ROTOR CIRCUITS 382
8-7 MODELS OF SYNCHRONOUS MACHINES FOR TRANSIENT ANALYSIS 386
8-8 SYNCHRONOUS-MACHINE DYNAMICS 390
8-9 SUMMARY 398
PROBLEMS 399

试读结束：需要全本请在线购买： www.ertongbook.com

9/Polyphase Induction Machines 409

9-1 INTRODUCTION TO POLYPHASE INDUCTION MACHINES 409
9-2 CURRENTS AND FLUXES IN INDUCTION MACHINES 413
9-3 THE INDUCTION-MOTOR EQUIVALENT CIRCUIT 416
9-4 ANALYSIS OF THE EQUIVALENT CIRCUIT 420
9-5 TORQUE AND POWER BY USE OF THEVENIN'S THEOREM 424
9-6 PERFORMANCE CALCULATIONS FROM NO-LOAD AND BLOCKED-ROTOR TESTS 429
9-7 SUMMARY 435
PROBLEMS 436

10/Polyphase-Induction-Machine Dynamics and Control 443

10-1 EFFECTS OF ROTOR RESISTANCE; DOUBLE-SQUIRREL-CAGE ROTORS 444
10-2 INDUCTION-MACHINE DYNAMICS 452
10-3 SPEED CONTROL OF INDUCTION MOTORS 455
10-4 ELECTRICAL TRANSIENTS IN INDUCTION MACHINES 459
10-5 APPLICATION OF ADJUSTABLE-SPEED SOLID-STATE AC MOTOR DRIVES 463
10-6 SUMMARY 469
PROBLEMS 469

11/Fractional-Horsepower AC Motors 479

11-1 SINGLE-PHASE INDUCTION MOTORS: QUALITATIVE EXAMINATION 480
11-2 STARTING AND RUNNING PERFORMANCE OF SINGLE-PHASE INDUCTION AND SYNCHRONOUS MOTORS 483
11-3 REVOLVING-FIELD THEORY OF SINGLE-PHASE INDUCTION MOTORS 491
11-4 UNBALANCED OPERATION OF SYMMETRICAL TWO-PHASE MACHINES; THE SYMMETRICAL-COMPONENT CONCEPT 498
11-5 TWO-PHASE CONTROL MOTORS 503
11-6 SERIES UNIVERSAL MOTORS 507
11-7 STEPPER MOTORS 508
11-8 AC TACHOMETERS 512
11-9 SYNCHROS AND CONTROL TRANSFORMERS 514
11-10 SUMMARY 518
PROBLEMS 519

Appendix A/**Three-Phase Circuits** 525

A–1 GENERATION OF THREE-PHASE VOLTAGES 526
A–2 THREE-PHASE VOLTAGES, CURRENTS, AND POWER 528
A–3 Y- AND Δ-CONNECTED CIRCUITS 532
A–4 ANALYSIS OF BALANCED THREE-PHASE CIRCUITS; SINGLE-LINE DIAGRAMS 539
A–5 OTHER POLYPHASE SYSTEMS 541

Appendix B/**Voltages, Magnetic Fields, and Inductances of Distributed AC Windings** 543

B–1 GENERATED VOLTAGES 543
B–2 ARMATURE-MMF WAVES 555
B–3 AIR-GAP INDUCTANCES OF DISTRIBUTED WINDINGS 553

Appendix C/**Table of Constants and Conversion Factors for SI Units** 557

Index 559

Magnetic Circuits and Transformers

The object of this book is to study the devices used in the interconversion of electric and mechanical energy. Emphasis is placed on electromagnetic rotating machinery, by means of which the bulk of this energy conversion takes place. Attention is also paid to the transformer, which, although not an electromechanical energy-conversion device, is an important component in the overall problem of energy conversion. Moreover, in many respects its analysis uses techniques closely related to those required for rotating machinery.

Practically all transformers and electric machinery use magnetic material for shaping and directing the magnetic fields which act as the medium for transferring and converting energy. Thus the ability to analyze and describe magnetic field quantities is an essential tool for understanding these devices. Magnetic materials play a large role in determining the properties of a piece of electromagnetic equipment and affect its size and efficiency.

This chapter will develop some basic tools for the analysis of magnetic

field systems and will provide a brief introduction to the properties of practical magnetic materials. These results will then be applied to the analysis of transformers. In later chapters they will be used in the analysis of rotating machinery.

In this book it is assumed that the reader has basic knowledge of magnetic and electric field theory such as given in a basic physics course for engineering students. Other readers may have had a course on electromagnetic field theory based on Maxwell's equations, but an understanding of Maxwell's equations is not a prerequisite for study of this book. The pertinent basic equations will be introduced in simplified form when required.

1–1 INTRODUCTION TO MAGNETIC CIRCUITS

The complete, detailed solution for magnetic fields in most situations of practical engineering interest involves the solution of Maxwell's equations along with various constitutive relationships which describe material properties. Although in practice exact solutions are often unattainable, various simplifying assumptions permit the attainment of useful engineering solutions.

The first assumption is that for the types of electric machines and transformers treated in this book the frequencies and sizes involved are such that the displacement-current term in Maxwell's equations can be neglected. This term accounts for magnetic fields being produced in space by time-varying electric fields and is associated with electromagnetic radiation. Neglecting this term results in the *magneto-quasi-static* form of Maxwell's equations. By this we mean that the magnetic field quantities are determined solely by the instantaneous values of the source currents and that the time variation of the magnetic fields follow directly from the time variations of the sources.

A second simplifying assumption involves the concept of the *magnetic circuit.* The general solution for the *magnetic field intensity* **H** and the *magnetic flux density* **B** in a structure of complex geometry is extremely difficult. However, a three-dimensional field problem can often be reduced to what is essentially a one-dimensional circuit equivalent, yielding solutions of acceptable engineering accuracy.

A magnetic circuit consists of a structure composed for the most part of high-permeability magnetic material. The presence of high-permeability material causes the magnetic flux to be confined to the paths defined by the structure, much as currents are confined to the conductors of an electric circuit. Use of this concept of the magnetic circuit is illustrated in this article and will be seen to apply quite well to many situations in this book.†

A simple example of a magnetic circuit is shown in Fig. 1-1. The core is

†For a more extensive treatment of magnetic circuits see A. E. Fitzgerald, D. E. Higgenbotham, and A. Grabel, "Basic Electrical Engineering." 5th ed., McGraw-Hill, New York, 1981, chap. 13; also E. E. Staff, MIT, "Magnetic Circuits and Transformers," MIT Press, Cambridge, Mass., 1965, chaps. 1 to 3.

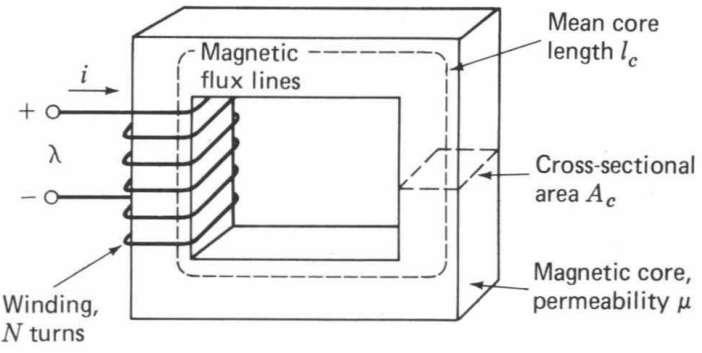

Fig. 1-1. Simple magnetic circuit.

assumed to be composed of magnetic material whose permeability is much greater than that of the surrounding air. The core is of uniform cross section and is excited by a winding of N turns carrying current i amperes (A). This winding produces a magnetic field in the core, as shown in the figure. The magnetic field can be visualized in terms of flux lines, which form closed loops interlinked with the winding. The basic relation between current i and the magnetic field intensity **H** states that the line integral of **H** around a closed path is equal to the net current enclosed by that path.

As applied to the magnetic circuit of Fig. 1-1, the source of the magnetic field in the core is the ampere-turn product Ni. In magnetic-circuit terminology Ni is the *magnetomotive force* (mmf) $\mathcal{F}$. Although Fig. 1-1 shows only a single coil, transformers and most rotating machines have at least two windings and Ni is the algebraic sum of the ampere-turns of all the windings. Under the assumption of uniform magnetic flux density across the core cross section, the line integral of **H** becomes simply the scalar product $H_c l_c$, of the magnitude of **H** along the mean flux path whose length is l_c. Thus, the relationship between the mmf and the magnetic field intensity can be written in magnetic-circuit terminology as

$$\mathcal{F} = Ni = H_c l_c \tag{1-1}$$

The direction of H_c in the core can be found from the *right-hand rule,* which can be stated in two equivalent ways. (1) Imagine a current-carrying conductor held in the right hand with the thumb pointing in the direction of current flow; the fingers then point in the direction of the magnetic field created by that current. (2) Equivalently, if the coil in Fig. 1-1 is grasped in the right hand (figuratively speaking) with the fingers pointing in the direction of the current, the thumb will point in the direction of the magnetic fields.

The relationship between the magnetic field intensity **H** and the magnetic flux density **B** is a property of the region in which the field exists; thus

$$\mathbf{B} = \mu\mathbf{H} \tag{1-2}$$

where μ is the *permeability*. In SI units **B** is in *webers per square meter,* known as *teslas* (T), and μ is in *webers per ampere-turn-meter,* or equivalently *henrys per meter*. In SI units the permeability of free space is $\mu_0 = 4\pi \times 10^{-7}$. The permeability of ferromagnetic material can be expressed in terms of μ_r, its value relative to that of free space, or $\mu = \mu_r\mu_0$. Typical values of μ_r range from 2000 to 80,000 for materials used in transformers and rotating machines. The characteristics of ferromagnetic materials are described in Arts. 1-3 and 1-4. For the present we shall assume that μ_r is a known constant, although it actually varies appreciably with magnetic flux density.

Because of the high permeability of the magnetic core, the magnetic flux is confined almost entirely to the core, the field lines follow that path defined by the core, and the flux density is essentially uniform over a cross section because the cross-sectional area is uniform.

The *magnetic flux* ϕ crossing an area is the surface integral of the normal component of **B**; thus

$$\phi = \int_S \mathbf{B} \cdot d\mathbf{a} \tag{1-3}$$

In SI units ϕ is in *webers*. In terms of field theory the continuity-of-flux equation

$$\oint_S \mathbf{B} \cdot d\mathbf{a} = 0 \tag{1-4}$$

states that the net magnetic flux crossing all surfaces of a three-dimensional closed surface (equal to the surface integral of B over that closed surface) is zero. This is equivalent to saying that all the flux which enters the surface enclosing a volume must leave that volume over some other portion of that surface because magnetic flux lines form closed loops. When flux outside the core is neglected, Eq. 1-3 reduces to the simple scalar equation

$$\phi_c = B_c A_c \tag{1-5}$$

where ϕ_c = the flux in core
B_c = flux density in the core
A_c = cross-sectional area of the core

The area is assumed to be constant throughout the length of the magnetic path. Because the field lines form closed loops, the flux is continuous throughout the length of the core.

Transformers are wound on closed cores like that of Fig. 1-1. Energy-conversion devices which incorporate a moving element must have air gaps in their magnetic circuits. A magnetic circuit with an air gap is shown in Fig. 1-2. When the air-gap length g is much smaller than the dimensions of the adja-

试读结束：需要全本请在线购买： www.ertongbook.com